


Section: <b>01</b>	Date: <b>2017-10-23</b>	Job ID: <b>1234-5678</b>	Client: <b>MINICAM</b>	Operator: <b>M.STARK</b>
-----------------------	----------------------------	-----------------------------	---------------------------	-----------------------------


Place: <b>GOLBORNE</b>	Direction: <b>Upstream</b>	Start Ref: <b>0401</b>
Road: <b>MARYFIELD CLOSE</b>	Use: <b>Combined</b>	Start Depth: <b>1.12m</b>
	Pipe Shape: <b>Circular</b>	End Ref: <b>9402</b>
	Pipe Material: <b>Concrete</b>	End Depth: <b>1.09m</b>
	Width / Height: <b>300mm</b>	

Comments: **WEATHER-LIGHT RAIN**

(0401) 0.80m

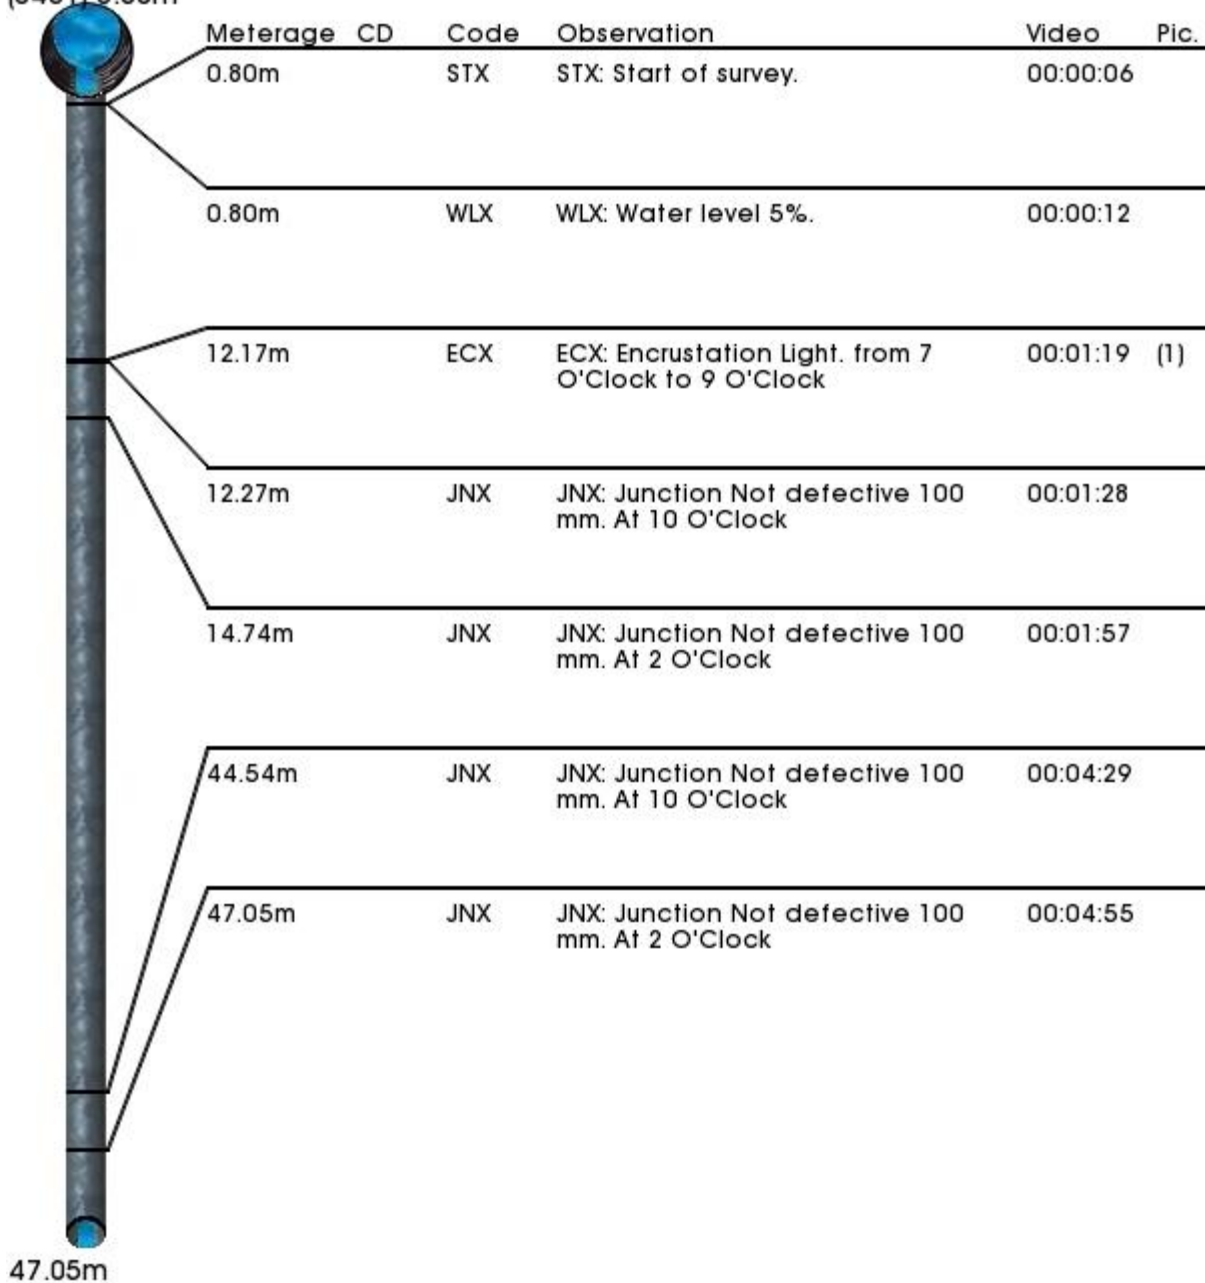

Section: <b>01</b>	Date: <b>2017-10-23</b>	Job ID: <b>1234-5678</b>	Client: <b>MINICAM</b>	Operator: <b>M.STARK</b>
-----------------------	----------------------------	-----------------------------	---------------------------	-----------------------------



Meterage	CD	Code	Observation	Video	Pic.
64.38m		JNX	JNX: Junction Not defective 100 mm. At 10 O'Clock	00:07:31	
66.66m		ECX	ECX: Encrustation Light. from 12 O'Clock to 5 O'Clock	00:07:59	(2)
66.96m		JNX	JNX: Junction Not defective 100 mm. At 2 O'Clock	00:08:15	
72.23m	S1	ECX	ECX: Encrustation Light. from 5 O'Clock to 7 O'Clock S1	00:09:06	(3)
75.35m	F1	ECX	ECX: Encrustation Light. from 5 O'Clock to 7 O'Clock S1	00:10:08	
75.35m		ENX	ENX: End of survey.	00:10:11	

Section: <b>01</b>	Date: <b>2017-10-23</b>	Job ID: <b>1234-5678</b>	Client: <b>MINICAM</b>	Operator: <b>M.STARK</b>
-----------------------	----------------------------	-----------------------------	---------------------------	-----------------------------



(1)



(2)

Section: <b>01</b>	Date: <b>2017-10-23</b>	Job ID: <b>1234-5678</b>	Client: <b>MINICAM</b>	Operator: <b>M.STARK</b>
-----------------------	----------------------------	-----------------------------	---------------------------	-----------------------------



(3)